



Review of Gully Erosion in Anambra State: Geology, Causes, Effects, Control Measures and Challenges Associated with Its Mitigation

**O. Oshim Francisca^{a*}, C. Ayajuru Nelson^a,
C. Anumaka Collins^a and S. Olayemi Opeyemi^b**

^a Department of Geological Science, Nnamdi Azikiwe University, Nigeria.

^b University of Ibadan, Nigeria.

Authors' contributions

This work was carried out in collaboration among all authors. All authors read and approved the final manuscript.

Article Information

DOI: 10.9734/JGEESI/2023/v27i9709

Open Peer Review History:

This journal follows the Advanced Open Peer Review policy. Identity of the Reviewers, Editor(s) and additional Reviewers, peer review comments, different versions of the manuscript, comments of the editors, etc are available here: <https://www.sdiarticle5.com/review-history/103578>

Mini-review Article

Received: 03/06/2023

Accepted: 07/08/2023

Published: 14/08/2023

ABSTRACT

In South-Eastern Nigeria, particularly in Anambra State, gully erosion presents a serious environmental challenge. With over 100 gully sites in the state, only about 30 have received measures of control but are still not fully under control. Observations have shown clearly that the underlying geology exerts major control over the development of gully erosion in the study area. Progressive gullies in certain areas of Anambra State are caused by various factors, including topography, soil and water pH, lithology type, deforestation, hydrogeology, and geotechnical rock properties. This erosion activity has resulted in the loss of productive lands, water pollution, sedimentation of waterways, and the loss of lives and properties almost every year. However, several government agencies have attempted to manage it using concrete structures, stabilization work such as planting bamboo and cashew trees to increase water intake, and pipe structures to

*Corresponding author: E-mail: franciscaoshim7@gmail.com;

channel the water directly to nearby surface waters through the construction of check dams, embankments, and retention ponds to control the flow of water and sediments. Despite these control efforts, several challenges persist in effectively managing gully erosion in Anambra State. Majority of the concrete structures used to control these gullies have collapsed, leading to the incessant spreading of the site. Inadequate funding, failure of engineering structures, flooding, the geologic setting of the area, limited technical expertise, population growth, urbanisation, a lack of public awareness, and a lack of proper coordination among stakeholders hinder the implementation of comprehensive erosion control measures. It is recommended that concrete drainage channels should not only be used in controlling these gullies but also be integrated with other measures to yield a positive result.

Keywords: Gully erosion; causes; effect; control; challenges; geology of Anambra state.

1. INTRODUCTION

Gully erosion occurs when surface water runoff removes soil along drainage lines. This environmental degradation can result in the loss of useful land that is utilized for farming, domestic, industrial, and other purposes. Additionally, it can cause damage to properties and even lead to loss of life [1,2,3]. According to [4], Anambra State in the Southeastern region of Nigeria has the highest number of active gullies, with many of them having failed gully-control measures. The gullies in this area can be described as catastrophic, as they are very deep and wide, with some even stretching for tens of kilometres. In fact, they could be better referred to as canyons [1,3,5]. Gullies in Anambra State have been attributed to a variety of factors by workers such as [1,6,7,8 and 9]. Some suggest that human activities have influenced natural and geological processes, while others believe that gullies are linked to concentrated runoff processes. [10] pointed to anthropogenic activities like rapid urbanization, rural-urban migration drift, overpopulation, indiscriminate dumping of household waste in drains, emission of ozone layer-depleting gases/burning of fossil fuels, hazardous industrial waste products, and heavy tropical rains as remote causes of gully erosion and flooding in the area.

Ezezika et al. [11] believed that roads without proper drainage or catchment pits, unguided cultivations that cause flooding, indiscriminate channelling of flood water on sloped terrain, intense rainfall on metal roofs without drains, large cracks in hills that form flood channels, and poor drainage systems are all contributing factors to gully erosion. [12 and 13] discussed the prevailing factors in the state that contribute to gully erosion, including topography, climate, vegetation, geology, soil, and human factors. [14]

points out that annual dynamic fluctuations in the groundwater table are another important factor that enhances gully initiation and growth in the area.

According to [15], topography plays a significant role in the development of gullies in the region.[8] suggests that the sequence of the contribution of soil erodibility factors to gully erosion frequency is slope > plasticity > cohesion > friction > population density, with percentage contributions of 30%, 23%, 20%, 18%, and 9%, respectively. Gully erosion is a major environmental problem that threatens the sustainability of both plants and animals in the world, and a large area of land in Anambra State is at risk. [16] stated that only a few of the erosion menace is under control.

[15] noted that an increase in hydraulic heads can enhance gully development through an increase in flow rate, and seasonal expansion and contraction of impermeable clayey and/or shaly materials can also increase the rate of gully development. [1 and 17] attributed gully erosion in Anambra State to the interaction of water flow with geological materials and the chemistry of the water and/or soil, as well as geotechnical properties and other anthropogenic factors.

[15] recommended preventive measures as the best strategy to keep erosion and other environmental problems at bay in Anambra State, while [6] highlighted the significance of the underlying geology, specifically the Imo shale, in controlling gully development. The phenomenon of gully erosion is rock-type dependent, with some rocks being more susceptible to erosion than others. Therefore, a brief review of the geology of Anambra State is necessary to understand why gully erosion is more prevalent in some parts of the state than in others [1,6,18].

1.1 Location of Study Area

Anambra State is located within latitude 6° 48' N and Longitude 6° 37'E on the North and Latitude 5° 40'N and longitude 7° 27'E on the South [1]. It has a total land area of 4,416sqkm [1]. The study area is in South-Eastern Nigeria.

2. GEOLOGY OF THE STUDY AREA

The study area lies within Anambra Basin and Niger Delta Basin. Anambra Basin is a product of tectonic disturbances in the area. The tectonic disturbance took place during the Santonian upliftment of Albian sediments in the lower Benue Trough. The subsequent deposition of sediments within the basin resulted in the formation of ancient Cretaceous deltas with Nkporo shale, Mamu formation, Ajali sandstone, and Nsukka formation dominating the sedimentary deposits. The distribution of these geologic formations and the general lithostratigraphic sequence has been

discussed by many researchers, such as [14,15,19-25].

The stratigraphy of the Niger Delta Basin has been intensively carried out and described by various workers. [19,20,26,27,28 and 29] have described the stratigraphy and palaeogeography of the Niger Delta. Moreover, [27] subdivided the upper Tertiary Delta Complex into three mega facies that are strongly diachronous and designated them as Akata, Agbada and Benin Formation from the base to the top. [30] in re-describing the lithostratigraphic units showed that the sediment deposition moved southwards in line with the general progradation of the Delta. During the Paleocene, a major transgression extended across entire southern Nigeria, terminating the advance of the Upper Cretaceous Delta and separating it stratigraphically from the modern Niger Delta which began to form in the Eocene. These include the Upper Nsukka Formation (350 m), Imo Formation (1000 m), Amekei Group (1900 m), and Ogwashi-Asaba Formation (250 m) [19],

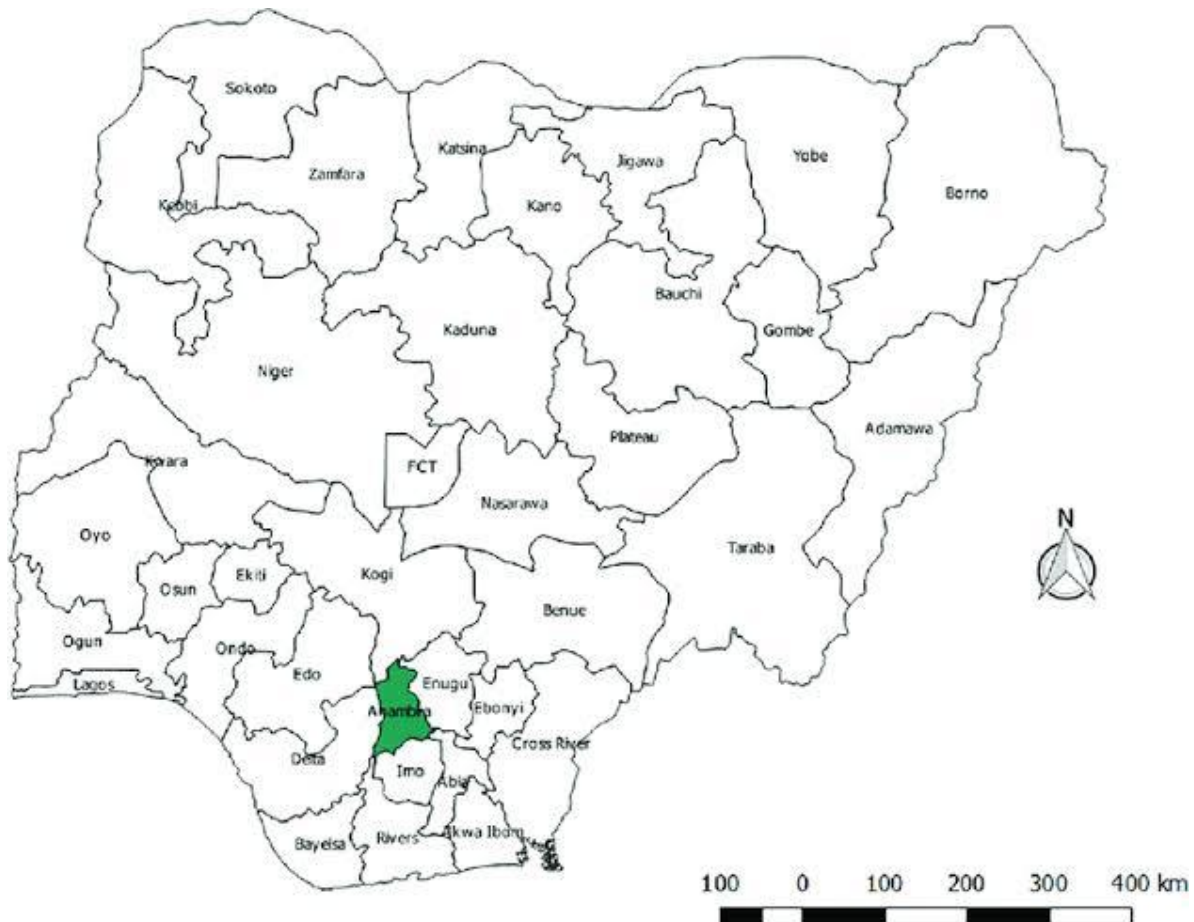


Fig. 1. Map of Nigeria showing the study area

[31-34]. The Ameki Group consists of the Nsugbe Formation, Nanka Sand and Ameki Formation [31], which are lateral equivalents. [31] interpreted the Nanka Sandstone as the facies of a tidally influenced marine shoreline and elevated it from being a member of the Ameki Formation to the status of formation forming part of the Ameki Group. The Ameki Group is conformably overlain by the Ogwashi-Asaba Formation. The Ogwashi-Asaba Formation consists of an interbedding of coarse-grained sandstone, lignite seams, and light-coloured clays of continental origin [35] referred to the Imo Shale, Ameki Group and Ogwashi-Asaba Formation as the oldest units of the Niger Delta, which extended into the subsurface where

different formation names were assigned to them [27] described the subsurface Akata Formation as a downdip continuation of the outcropping Imo Shale. The Agbada Formation is also referred to as the down-dip continuation of the outcropping Ameki Group and Ogwashi-Asaba Formation.

The geological setting in the study area is that of layered sequences in which a predominantly sandstone formation (Ameki group) is underlain by a predominantly shale formation (Imo shale) [1,36,37,24].

Stratigraphic succession in the Anambra Basin and Niger Delta Basin (redrawn and modified from [24,38,37,27].

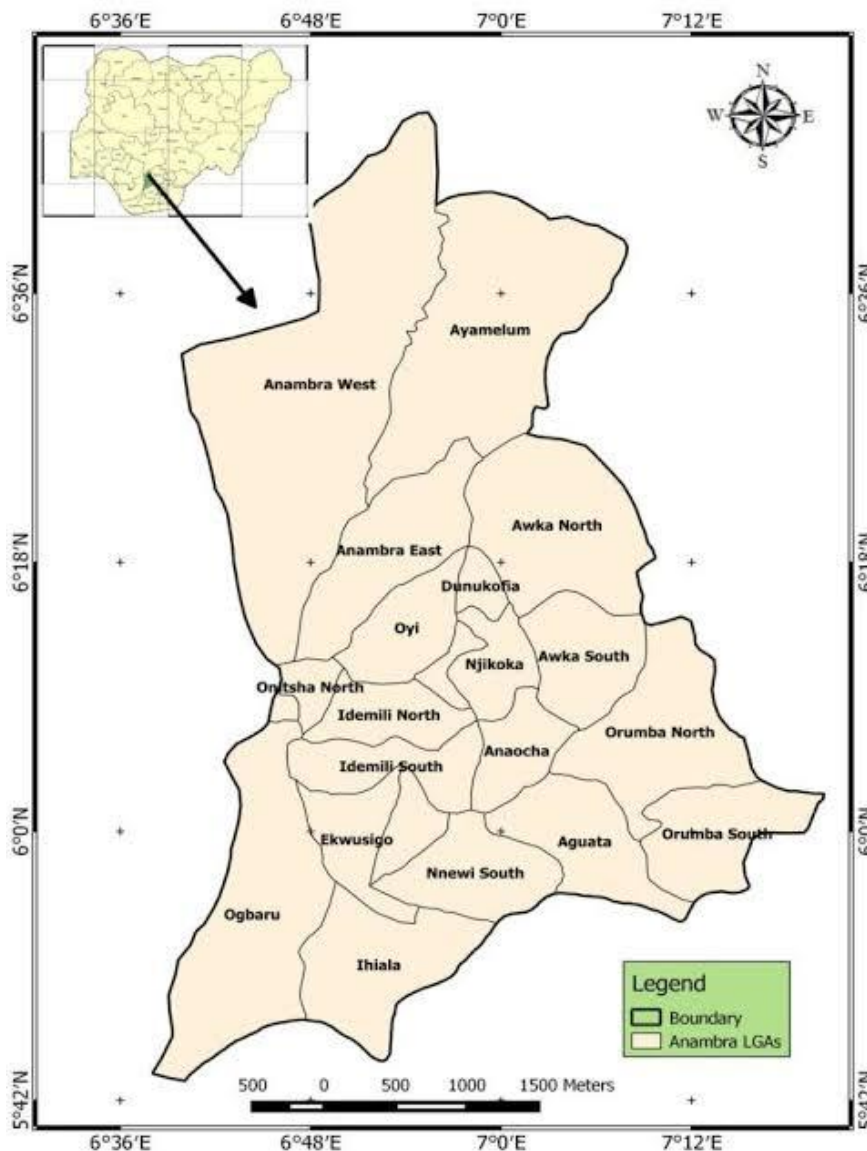


Fig. 2. Map of Area of Study

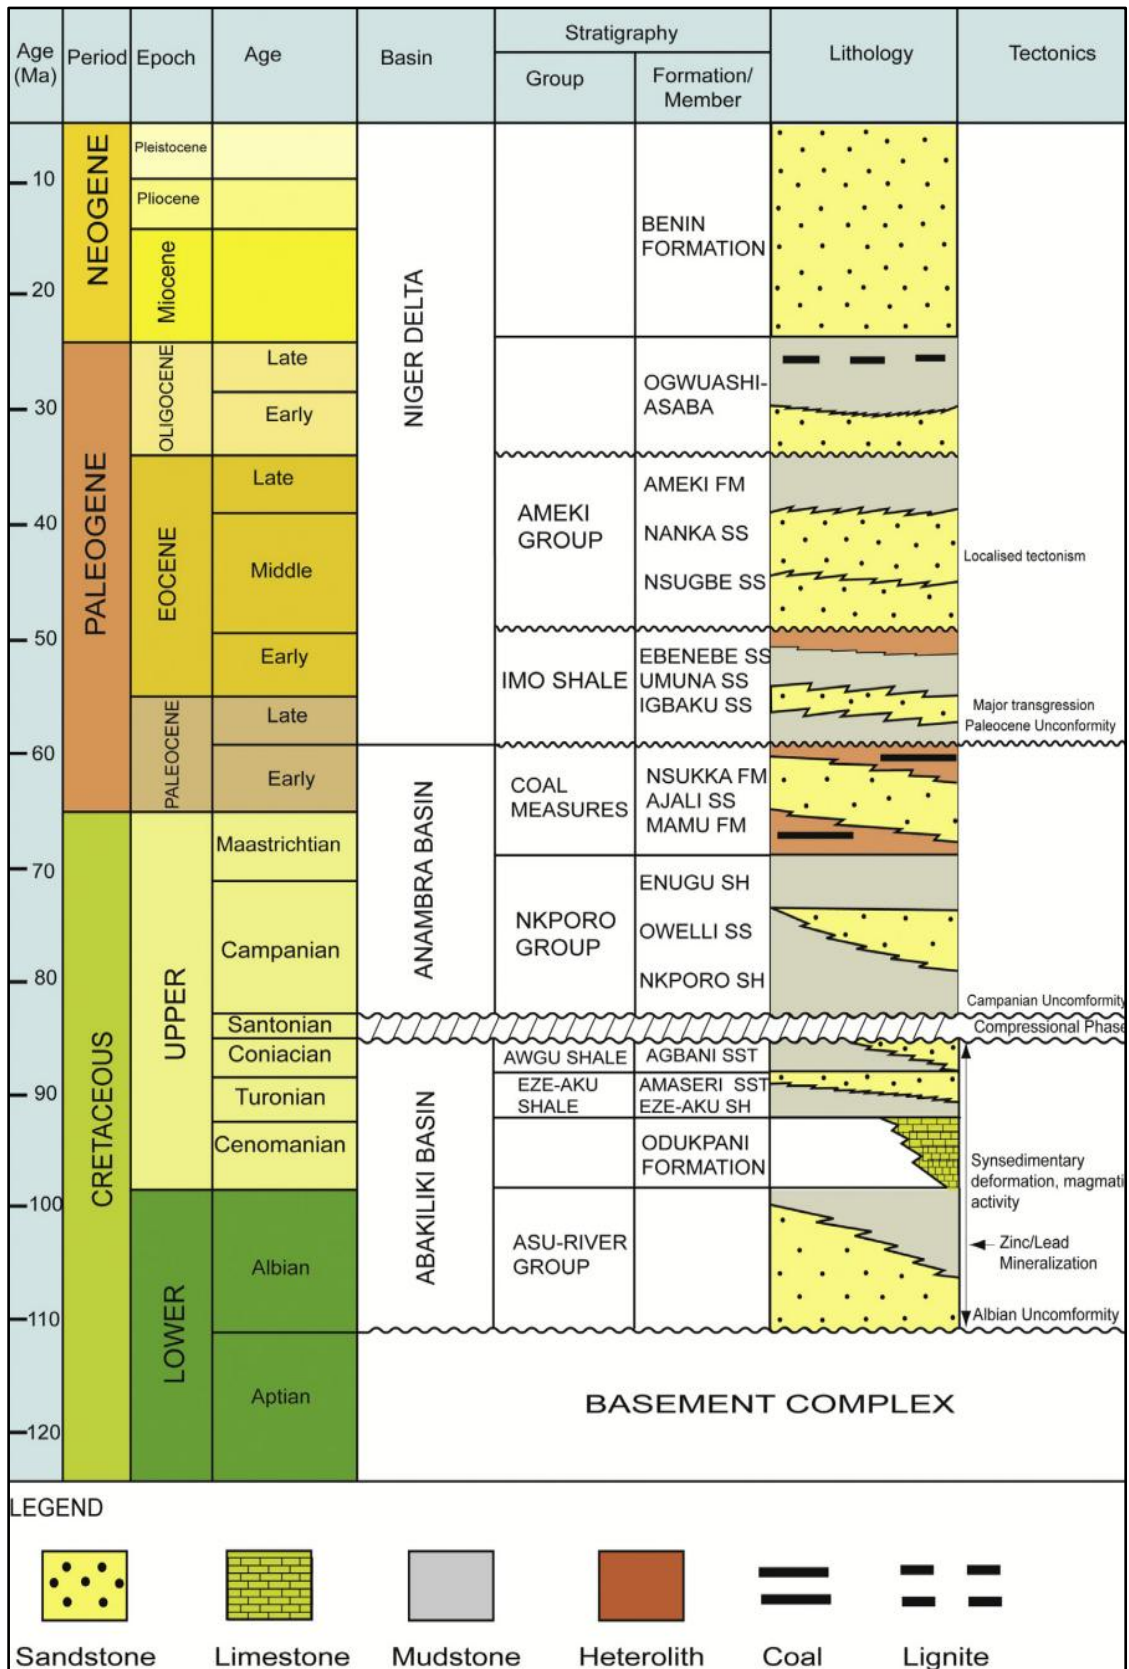


Fig. 3. The stratigraphic succession of the Anambra Basin and the Niger Delta [37]

2.1 Imo Shale

The Imo Shale (Palaeocene –Lower Eocene) is the oldest stratigraphic unit in Niger Delta Basin. It is a transgressive sequence of (fine grain) dark grey shale and outcrops on the plane of the Mamu River [1]. No active gullies are found in this formation. This is because the formation is impermeable, cohesive and resistant to weathering. Imo shale is known to have low permeability, which means that it has limited ability to allow water to pass through. When water encounters shale outcrops, it tends to accumulate on the surface rather than infiltrate into the ground. This reduces the volume and

velocity of water runoff, mitigating the erosive force that typically leads to gully formation. Shale exhibits cohesive properties due to its fine-grained composition. The cohesiveness of Imo shale helps bind its particles, making it resistant to erosion by flowing water, even if water runoff occurs, it has limited ability to dislodge and transport the shale particles, preventing the development of new gullies. Imo shale is relatively resistant to weathering compared to sandstone formation (Ameki Group). Imo shale exerts a major control on gully development by decreasing the infiltration rate and increasing the erodibility of the overlying formation (Ameki Group).

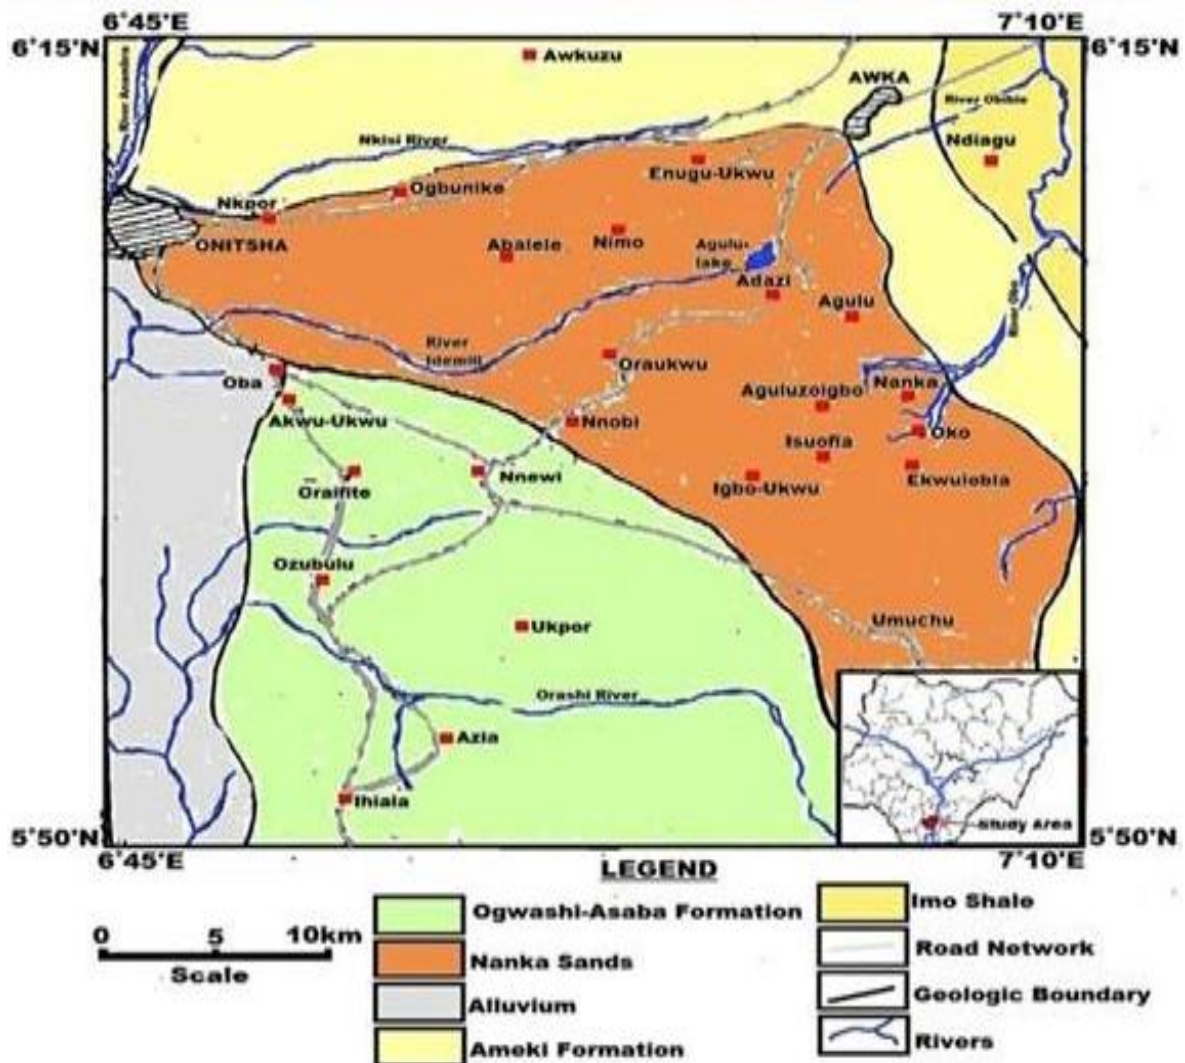


Fig. 4. Geologic map showing the geology of the study area [41]

2.2 Ameki Group

Ameki formation, Nanka sandstone, and Nsugbe Sandstone are the members of the Ameki group which is one of the oldest stratigraphic units of the Niger Delta Basin [21,39,40,41]. The Ameki Formation consists of alternating sandy shale, clayey sandstone, fossiliferous shale (consisting of molluscs, foraminifera, and corals), and fine-grained argillaceous sandstone with thin limestone bands. The Ameki Group is conformably overlain by the Ogwashi-Asaba Formation [37]. The Ogwashi-Asaba Formation consists of an interbedding of coarse-grained sandstone, lignite seams, and light-coloured clays. The Ameki Formation (Middle–Upper Eocene) is a regressive sequence. Active gullies of enormous magnitude are found in this unit [1], [36]. This is because the formation is very permeable and therefore increases infiltration and percolation, allowing water to infiltrate easily. This porous and very permeable formation is underlain by an impermeable formation known as Imo shale [1]. Gully erosion is more prevalent in the Ameki group compared to shale formation due to the contrasting properties and characteristics. The Ameki Formation often consists of unconsolidated sandy and loamy soils which are more prone to erosion. Ameki formation often exhibits a steeper slope compared to shale formation. Steep slopes accelerate the speed and force of water runoff increasing erosive energy and promoting gully formation.

3. CAUSES OF GULLY EROSION IN ANAMBRA STATE

As previously noted by [18], the Anambra State has seen an increase in gully erosion, which has led to numerous researchers investigating the underlying causes. Consequently, there is a wealth of literature available on the topic from the region. The literature suggests that gully erosion in Anambra State is caused by a combination of factors, including the type of lithology in the area, topography, pH of soil/water, heavy rainfall, and anthropogenic factors. [1,4,7,6,8, 14,42,43,45,48,49].

3.1 Type of Lithology/Hydrogeological Condition of the Area

The study area of Anambra State experiences gully erosion due to its geological setting [6]. The hydrogeology of certain areas affects the rate and pattern of surface water runoff. Sandy

geologic formations, specifically those in the Ameki Group, are more easily eroded than shaley ones, such as the IMO shale [7]. The interaction between soil strength and groundwater contributes to gully erosion in areas like Nnaka and Ekwulobia [1]. During rainfall, the Ameki group's top unit becomes porous and highly permeable, causing water to flow vertically to reach the impermeable Imo shale. This reduces infiltration and percolation, saturating the topsoil with water and increasing runoff. As a result, the soil becomes easily eroded along drainage lines [7,8]. The rocks' unconsolidated, friable, and loose nature also enhances their erodibility, as the bond holding sand grains together is weak [43,48]. Additionally, the movement of groundwater can weaken soil and rock stability, leading to excessive erosion in certain parts of Anambra State [44].

3.2 Topography of the Area

The erosion of hilly or mountainous terrains with steep slopes and sandy areas can lead to the formation of escarpments. These areas, such as Agulu, Nanka, and Alor-Oraukwu in the state, are highly susceptible to erosion due to the continuous geomorphic evolution of the landscape. The vegetation in this region is determined by the topography and geologic factors. The landform is divided into two parts, with the southern part being higher at an elevation of 240-390m, while the northern and southeastern parts are low-lying at 40-140m [1], [7]. According to [8], areas with high susceptibility to erosion are usually along steep slopes, which coincide with the boundary of two major soil types, shale, and sand. In some parts of the Anambra state, gully activities occur due to the gradual cutting of the sandstone Formation (Ameki group) down to the water base level at the underlying shale Formation, the Imo shale [8,43,48].

3.3 The pH of the Soil/Water

The formation and growth of gullies in Anambra State are influenced by chemical weathering [1], [41,42]. The geochemical composition of rocks and soil affects their geotechnical properties [44]. In some parts of Awka, water chemistry is controlled by sodium bicarbonate and mixed types, with the predominant water type being sodium bicarbonate (NaHCO₃) [45]. The high percentage of sodium water suggests the possibility of ion exchange reaction and mineral dissolution, which could cause soil grains to

loosen and host rocks to disintegrate [45]. Surface water and groundwater in some areas of the study region have pH values ranging from 5.53 to 6.58mg/l with an average value of 5.99 and 5.48 to 6.4mg/l with an average value of 6.31mg/l, indicating slightly acidic water. The slightly acidic nature of the water may be due to carbon dioxide dissolved in rain water and decayed organic matter in the soil [41,45,46].

The acidic nature of both surface and groundwater plays a significant role in the decomposition of cement that holds rock particles together. This leads to erosion through

mass wasting and excess runoff [1,14,41]. Unfortunately, this acidic water can also cause damage to engineering structures such as dams and concrete drainage channels built to control gullies. Erosion sites are often located near densely populated small towns and villages, as mentioned in [1,8]. In areas like Nnaka, the soil's pore spaces contain slightly acidic water that attacks the binding cement, causing the soil to loosen. This makes the soil highly reactive, causing ions such as Ca⁺, Na⁺, and Mg⁺ to be leached out by rainfall and carried to the ocean, where they form salts with chlorine and other elements [1,41,45,46].

Table 1. Particle size distribution of the selected sites [41]

Site	Sand (%)		Clay (%)		Silt (%)	
	Top Soil	Sub Soil	Top Soil	Sub Soil	Top Soil	Sub Soil
Agu-Awka	80.51	74.23	6.19	24.33	13.3	9.0
Agulu	84.01	70.99	10.43	23.36	5.56	5.56
Nanka	69.31	72.01	24.27	23.49	6.42	4.50
Ekwulobia	69.91	75.11	10.99	18.11	19.1	6.78
Ogidi	97.70	93.40	2.2	6.49	0.10	0.11

Table 2. range of values for physiochemical parameters for surface water and groundwater [45]

Hydrochemical surface water samples			Groundwater samples		WHO(2012) sandand
Parameters\location	Range	Average	Range	Average	
p ^H	5.53-6.58	5.99	5.58-6.4	6.30	.5-8.0
Total hardness	10.52	3.5	13-70	31.71	<100
TDS	16-150	63.16	22.3-140	50.9	600
Bicarbonate mg/l	3.14-65	37.85	8.0-50	25.49	-
Sulphate mg/l	2.0-4.53	3.81	<1-5.0	8.49	250
Chloride mg/l	3.78-35	22.28	4.2-40	15.09	250
Nitrate mg/l	0.47-7.49	4.73	4.95-23.9	11.61	50
Magnesium ppm	0.09-3.12	1.56	0.69-5.0	2.96	20
Calcium pmm	0.83-4.07	3.40	2.4-8.0	3.50	0.003
Iron ppm	0.03-0.78	0.38	<0.1-0.26	0.23	0.3
Sodium ppm	0.02-4.680	2.27	0.3-4.15	2.6	200

Table 3. Results of other physicochemical properties of the selected sites in the study area [41]

Site	pH		SR (cm/ μ s)		SOMC (%)		LOI (%)		CEC (cmol _c /kg)	
	Top Soil	Sub Soil	Top Soil	Sub Soil	Top Soil	Sub Soil	Top Soil	Sub Soil	Top Soil	Sub Soil
Agu-Awka	6.48	6.56	0.00065	0.00030	2.25	1.83	39	34.5	0.20	0.44
Agulu	6.72	6.43	0.0357	0.00357	2.30	1.64	42	25	2.08	0.34
Nanka	5.87	7.13	0.0133	0.033	1.16	1.67	58.5	42.5	2.08	0.29
Ekwulobia	6.78	6.38	0.0074	0.0087	1.30	1.23	47/0	46	1.15	0.31
Ogidi	6.48	6.39	0.0052	0.0500	2.08	1.41	50.5	28	2.11	0.42

SR – Soil Resistivity; SOMC – Soil organic matter content; LOI – Loss on ignition; CEC – Cation Exchange Capacity

3.4 Deforestation/Heavy Rainfall

When deforestation occurs, the soil is left exposed to the elements and rainfall. This can lead to soil compaction and erosion along drainage lines [1,7]. Soil becomes more erodible as compaction increases, as it reduces water infiltration and increases surface runoff [1,7]. This indicates that the soils in Anambra state meet the Federal Government's requirements for non-weak soils. However, high compaction values in the state indicate a high susceptibility to erosion. As compaction increases, so does a soil's erodibility and bulk density [8].

3.5 Other Anthropogenic Factors

Poorly terminated urban drain terminals and inadequate outlet structures at the end of drains are among the most common human-caused factors that lead to gully erosion [6,8]. When runoff is concentrated through a culvert or drain outlet into a lower ground basin, it creates a waterfall, which can result in a gully-head [6,8].

This gully head can recede and grow larger, eventually swallowing up the drainage channel and putting stress on the environment, potentially leading to soil erosion and landslides [7].

4. EFFECT OF GULLY EROSION

The negative effects of gully erosion in Anambra state are significant for both humans and the environment. It causes water pollution, loss of arable land for farming, discoloration of water, sedimentation of waterways, and property dissection, which leads to management difficulties and destruction of both life and property [47]. Gully erosion has resulted in the loss of a vast area of farmland, with many others at various stages of destruction. This leads to a significant decrease in agricultural productivity, ultimately leading to food shortages and impacting farming. In addition, when a gully is located near an unconfined aquifer, the dirty water from the gully can recharge the aquifer, leading to contamination [1,6].



Fig. 5. Onset of gully erosion triggered by deforestation and topsoil excavation [1]



Fig. 6. A Gully Site in Umuchiana, Aguata, showing the dissection of the access road [12]



Fig. 7. Gully site at Obinagu village showing loss of productive land [7]

4.1 Control

In order to effectively control gully erosion, two approaches need to be taken: addressing issues in the catchment and stabilizing the gully walls. Civil engineering works such as constructing concrete embankments and grouting can stabilize the walls [1]. To prevent developers from erecting structures along natural drains without appropriate channelling or alternative drains, it is recommended to enact and enforce necessary legislation [15]. Workshops, seminars, and symposiums should be organized to educate communities in Anambra state, while environmental campaign awareness, construction of stormwater sock away, good farming practices, and construction of control dams, ditches up the valley, and earth dams of adequate capacity should be encouraged [10].

Applying simple grouting and stabilization at an early stage of development can effectively control gullies [1]. Pipeline structures can be used to control excess runoff and channel water to nearby surface water. Materials used for

construction in slightly acidic areas should be acid-resistant [1]. Developing agroforestry nurseries with erosion control species for distribution to rural areas is recommended [7]. Adopting tree-planting techniques and extensive afforestation programs can also effectively control gully erosion [50].

The "catch them young" approach should be emphasized, using agro-forestry practices and other preventive techniques in areas not yet seriously affected by soil and gully erosions [7]. Retarding structures such as sedimentation weirs, wooden groynes or wicker-work fences, diversions, and berms can be used to control gullies in Nanka, Adazi-Nnukwu, and Agulu [50]. Controlling groundwater levels by installing wells and dewatering facilities at strategic locations is necessary to check gully erosion, as the hydrogeology of the area influences the development and growth of the gully [1]. Gully-prone areas should be delineated, and human activities such as agriculture and civil works should be controlled as they act as gully triggers and catalysts [1].



Fig. 8. Control measure put in place to check gully erosion [1]

4.2 Challenges of Controlling These Gullies

Various attempts by both state and federal governments to control gullies have been made, but they are still facing challenges due to lack of funds, ineffective engineering structures, geological conditions of the area, lack of awareness among the public, an increase in rainfall, inadequate funding for recommended control measures, failure to adhere to proposed drainage designs, and improper land use practices cited in sources [8,18,49]. Large sums of money, running into the hundreds of millions of naira, are required to control these gullies. Concrete structures have been used to control numerous gully sites, such as Awka, Mbaukwu, Agulu, Nanka, Ekwulobia, Nnewi, Nnewichi, AdaziNnukwu, and Nsugbe Erosion Sites, by both the state and federal governments [18]. However, a closer inspection indicates that many of these concrete structures have failed, leading to the continual widening of the controlled sites. Failed structures can be found at St. Theresa's Catholic Church Gully Erosion Control Project in Agulu, Umuchu Gully Erosion Control Project, and Nnewichi Gully Erosion Control Projects [18]. Concrete structures are prone to failure when used in deep gullies that are heavily impacted by groundwater, particularly when the gully floors are in highly permeable and friable sands. This can be attributed to the geological setting of the area, which consists of the Ameki group and the Imo shale.

5. CONCLUSION

Gully erosion is a major problem in Anambra state, caused by both natural and human factors. Nearly 70% of the land in the state is at risk, but only 3% of the erosion is being controlled. Using concrete drainage structures alone is not always effective in controlling deep gullies with high water currents. To solve the problem, experts recommend using a combination of solutions, including better concrete structures, channelization, and afforestation. Addressing the issue requires the collaboration of government agencies, local communities, researchers, and other stakeholders. This includes investing in erosion control measures, capacity-building programs, and sustainable land use policies. It is also important to integrate climate change adaptation strategies to minimize future erosion risk. By taking these steps, Anambra state can protect its resources, communities, and ensure a sustainable future.

COMPETING INTERESTS

Authors have declared that no competing interests exist.

REFERENCES

1. Obiadi II, Nwosu CM, Ajaegwu NE, Anakwuba EK, Onuigbo NE, Akpunonu EO, et al. Gully Erosion in Anambra State, South East Nigeria: Issues and Solution. *International Journal of Environmental Sciences*. 2011; 796-806. Available: https://www.researchgate.net/profile/IObiadi/publication/281406997_Gully_Erosion_in_Anambra_State_South_East_Nigeria_Issues_and_Solution/links/55e5ac9208aede0b5736bef6/Gully-Erosion-in
2. Nwaezeapu VC, Tom IU, David ETA, Vivian OO. Hydrocarbon Reservoir Evaluation: a case study of Tymot field at southwestern offshore Niger Delta Oil Province, Nigeria. *Nanosci Nanotechnol*. 2018;2(2). Doi:10.18063/nn.v0i0.618
3. Ibekwe KN, Oguadinma VO, Okoro VK, Aniwetalu E, Lanisa A, Ahaneku CV. Reservoir characterization review in sedimentary basins. *Journal of Energy Research and Reviews*. 2023;13(2):20-28.
4. Onyeka JO, Obi LE, Uwanugo RGU. Erosion Control in the Erosion-Ravaged Area of Nanka – Adazi-Nnukwu – Agulu Axis of Anambra State, Nigeria, *International Journal of Constructive Research in Civil Engineering*. 2019;9-19.
5. Okagbue CO, Ezechi JC. Geotechnical characteristics of soils susceptible to severe gully erosion in eastern Nigeria. *Bul. Of International Asso. Of Engineering Geology*. 1988; 38: 111-119.
6. Abdulfatai IA, Okunlola IA, Akande WG, Momoh LO, Ibrahim KO. Review of Gully Erosion in Nigeria: Causes, Impacts and Possible Solutions. *Journal of Geosciences and Geomatics*. 2014; 2: 125-129. DOI: 10.12691/jgg-2-3-8
7. Okoye CO, Emengini EJ, Onwuzuligbo C. Environmental Sensitivity Index Mapping and Assessment of Gully Erosion Sites in Anambra State-Nigeria. *Journal of Environment and Earth Science*. 2014.
8. Emeh C, Igwe O, Ugwuoke TAS. Geospatial analysis of factors driving gully erosion: A case study from Southeastern Nigeria. *Natural Hazards*, Springer. 2023;

- Available;<https://doi.org/10.21203/rs.3.rs-1606049/v1>
9. Aniwetalu, et al. Spectral analysis of Rayleigh waves in the Southeastern part of Niger Delta, Nigeria. *Int J Adv Geosci.* 2018;6:51-6.
<http://dx.doi.org/10.14419/ijag.v6i1.8776>
 10. Nwabine EO and Ezech CC. Gully and flooding in Anambra State: The way forward. *Journal of Environmental and Earth Science*; 2013.
 11. Ezezika OC, Olorunfemi A. Resolving the gully erosion problem in southeastern Nigeria: innovation through public awareness and community-based approaches. *Journal of soil science and environmental management.* 2011;2: 286-291.
 12. Igbokwe JI, Akinyede JO. Dang BA, Ono MN, Nnodu VC, Anike L. Mapping and Monitoring of the Impact of Gully Erosion in Southeastern Nigeria with Satellite Remote Sensing and Geographic Information System, *The International Archives of the Photogrammetry, Remote Sensing and Spatial Information Sciences*; 2008.
 13. Igwe CA. Gully erosion in southeastern Nigeria: Role of soil properties and environmental factors. *Research on Soil Erosion*, G. Danilo, Ed., *InTech*; 2012.
Doi:10.5772/51020
 14. Egboka BCE, Okpoko EI. Gully erosion in the Agulu-Nanka region of Anambra State, Nigeria. *Challenges in African Hydrology and Water Resources: Proceedings of the Harare Symposium*, IAHS Publ. 1984;144: 335–347.
 15. Okeyeh EI, Akpan AE, Egboka BC, Okeke HI. An Assessment of the influence of surface and subsurface water level dynamics in the development of gullies in Anambra State, southeastern Nigeria. *Earth science interaction.* 2013; 8:1-4.
 16. Okagbue CO, Uma KO. Performance of gully erosion control measures in southeastern Nigeria. *Proceeding of the International Symposium on Forest Hydrology and Watershed Management*, Vancouver, Canada. IAHS Publication. 1987;167:163-172
 17. Egboka BCE, Nwankwor GI. The hydrogeological and geotechnical parameters as causative agents in the generation of erosion in the rain forest belt of Nigeria. *Journal of African Earth Sciences.* 1986;3: 417-425.
 18. Onwuka SU, Okoye CO. Assessment of the effectiveness of the use of concrete structures in managing gully erosion in Anambra state, Nigeria. *World Journal of Environmental Sciences & Engineering.* 2014;1-10.
 19. Reyment RA. *Aspects of the Geology of Nigeria.* University of Ibadan Press. 1965; 145.
 20. Murat RC. Stratigraphy and Paleogeography of Cretaceous and Lower Tertiary in the Southern Nigeria. In: Dessauvage, T.F.G and Whiteman, A.J., Eds., *African Geology*, University of Ibadan Press, Ibadan. 1970;251-266.
 21. Oguadinma et al. Lithofacies and Textural Attributes of the Nanka Sandstone (Eocene): proxies for evaluating the Depositional Environment and Reservoir Quality. *J Earth Sci Geotech Eng.* 2014; 9660:4(4)2014:1-16 ISSN: 1792-9040 (print).
Available:http://www.scienpress.com/Upload/GEO/Vol%204_4_1.pdf
 22. Oguadinma, Okoli N, Ezenwaka K . An integrated approach to hydrocarbon prospect evaluation of the Vin field, Nova Scotia Basin. S.E.G. technical program expanded Abstracts. *International Exposition and Annual Meeting*, Dallas, Texas. 2016; 99-110.
Doi: 10.1190/segam2016-13843545.1.
 23. Oguadinma VO, Aniwetalu EU, Ezenwaka KC, Ilechukwu JN, Amaechi PO, Ejezie EO. Advanced study of seismic and well logs in the hydrocarbon prospectivity of Siram Field, Niger Delta basin. *Geol Soc Am Admin Programs.* 2017;49.
DOI: 10.1130/abs/2017AM-296312
 24. Oguadinma V, Okoro A, Reynaud J, Evangeline O, Ahaneku C, Emmanuel A et al. The art of integration: A basic tool in effective hydrocarbon field appraisal. *Mediterranean Geosciences Union Annual Meeting*; 2021.
 25. Oguadinma VO, Kelechi IN, Ademola L, Arukwe MC. Ahaneku VC. Reservoir and sequence stratigraphic analysis using subsurface data. *ESS Open Arch.* February 09; 2023.
Available:<https://doi.org/10.22541/essoar.167591074.46965817/v1>
 26. Frank, EJ, Cordry EA. The Niger Delta Oil Province. *Recent Developments Onshore and Offshore*, *Proceedings of the Seventh World Petroleum Congress*, Mexico City. 1967; 1B: 195-209.

27. Short KC, Stauble AJ. Outline of Geology of Niger Delta. AAPG Bulletin. 1967; 51: 761-779.
28. Adeleye DR. Nigerian Late Cretaceous Stratigraphy and Paleogeography. AAPG Bulletin. 1975; 59 (12): 2302-2313.
29. Weber, KJ, Daukoru EM. Petroleum geology of the Niger Delta. In Proceedings of the 9th World Petroleum Congress, Geolog. 1975;2: 210–221. London: Applied Science.
30. Avbovbo AA. Tertiary Lithostratigraphy of Niger Delta. American Association of Petroleum Geologists Bulletin. 1978; 62: 295-300.
31. Jan Du Chêne RE, Salami MB. Palynology and Micropaleontology of the Upper Eocene of the well Nsukwa 1 (Niger Delta, Nigeria). Archives des Sciences. 1978; 13(1): 5–9.
32. Nwajide CS. Eocene tidal sedimentation in the Anambra Basin, southern Nigeria. Sediment. Geol. 1980; 25:189-207.
33. Arua I. Paleoenvironment of Eocene deposits in the Afkpo syncline, southern Nigeria. J Afr Earth Sci . 1986;5:279 –284
34. Ogunleye PO, Oyebanji OJ, Awonusi FO. Seismic stratigraphy and depositional environment of Oligocene-Miocene sediments, western offshore, Niger Delta Basin. Journal of African Earth Sciences. 2020; 163: 103699.
35. Petters SW. Regional geology of Africa: Berlin, Springer-Verlag, Lect. Notes Earth Sci. 1991
36. Ezechi JI and Okagbue CO. A genetic classification of gullies in eastern Nigeria and its implications on control measures. Journal of African Earth Science. 1989 9; 711-718.
37. Ekwenye OC, Nichols GJ, Collinson M, Nwajide CS, Obi GC. A paleogeographic model for the sandstone members of the Imo Shale, south-eastern Nigeria O.C. Journal of African Earth Sciences. 2014;96:190–211. Available:<http://dx.doi.org/10.1016/j.jafrearsci.2014.01.007>
38. Nwajide CS., Reijers TJA. A geological field excursion to parts of the Anambra Basin Nigeria, In NAPE mini-conference held at the Federal University of Technology, Owerri 7-8 May 2004,1-28.
39. Nwajide CS, Hoque H. Gullying processes in southeastern Nigeria. The Nigerian Fields. 1979; 44:64-74.
40. Olajubaje TA, Akande SO, Adeoye JA, Adekeye OA., Friedrich C. Depositional Environments and Geochemical Assessments of the Bende Ameki Formation Potential as Petroleum Source Rocks in the Ogbunike Quarry, South-Eastern Nigeria. European Scientific Journal. 2018;14:1857–7881. Available:<http://dx.doi.org/10.19044/esj.2018.v14n27p157>
41. Okeke CH , Ubaoji KI , Uzodinma FC. Interaction of Chemical, Physicochemical, and Geotechnical Soil Properties of Anambra State Gully Erosion Sites, Saudi Journal of Civil Engineering. 2021; 379-390. 10.36348/sjce.2021.v05i10.001.
42. Ofomata GEK. Geographical Perspective, on Environmental Problems and Management in Nigeria”, Jamoe Publishers Nigeria. 2007
43. Emeh C, Igwe O. Variations in soils derived from an erodible sandstone formation and factors controlling their susceptibility to erosion and landslide. J Geol Soc India. 2017; 90(3):362–370
44. Onwo ES, Emeh C, Igwe O. Effect of geochemical composition of lateritic soils on their geotechnical properties. Indian Geotech J. 2022. Available:<https://doi.org/10.1007/s40098-022-00628-w>
45. Chibuzor SN, Egboka BCE, Anakwuba EK, Onuigbo EN, Odokuma-Alonge O, Ben-Owope OA et al. Hydrochemical and Geological Investigations of Some Gully Erosion- Prone Areas in Parts of Awka-Orlu Cuesta, Nigeria. Research Square. 2023. DOI:<https://doi.org/10.21203/rs.3.rs-2548569/v1>
46. Hem JD. Study and interpretation of the chemical characteristics of natural water, 3rd edition. US surv Water-supply pap 1989;254-263.
47. Igwe PU, Ajadike JC, Ogbu SO. Assessment of Gully Erosion Problems for its Remediation in Eastern Nigeria. Journal of Environmental Management and Safety. 2023;14(2):72-88
48. Egboka BCE, Nwankwor GI, Orajaka IP. Implications of paleo-and neotectonics in gully Erosion prone area of southeastern Nigeria. Natural Hazards Journal. 1990; 3: 219-23
49. Akpokodje EG, Tse AC, Ekeocha N. Gully erosion geohazards in south-eastern

- Nigeria and management implications.
Scientia Africana. 2010;9(1):20-36
50. Onyeka JO, Obi LE, Uwanugo RGU.
Erosion Control in the Erosion-Ravaged
Area of Nanka – AdaziNnukwu – Agulu.
International Journal of Constructive
Research in Civil Engineering (IJCRCE).
2019;5(2):9-19.
DOI:<http://dx.doi.org/10.20431/2454-8693.0502002>

© 2023 Francisca et al.; This is an Open Access article distributed under the terms of the Creative Commons Attribution License (<http://creativecommons.org/licenses/by/4.0>), which permits unrestricted use, distribution, and reproduction in any medium, provided the original work is properly cited.

Peer-review history:

The peer review history for this paper can be accessed here:
<https://www.sdiarticle5.com/review-history/103578>